Twin Falls County, Idaho
Recorded for
JUB ENGINEERS
09:50am Jun.16.2003
2003 – 015368
No. of Pages: 2 Fee: $22.00
ROBERT S. FORT
Ex-Officio Recorder
Deputy: CH

A RE-PLAT OF

LOTS 2–8, BLOCK 1 AND A PART OF LOT 1, BLOCK 2 OF FLORENCE WILSON ADDITION

A PORTION OF GOVERNMENT LOT 4, SEC. 6, T. 10 S. R. 15 E. BOISE MERIDIAN
CITY OF BUHL
TWIN FALLS COUNTY, IDAHO
2003

60 30 0 60 120 180
SCALE IN FEET

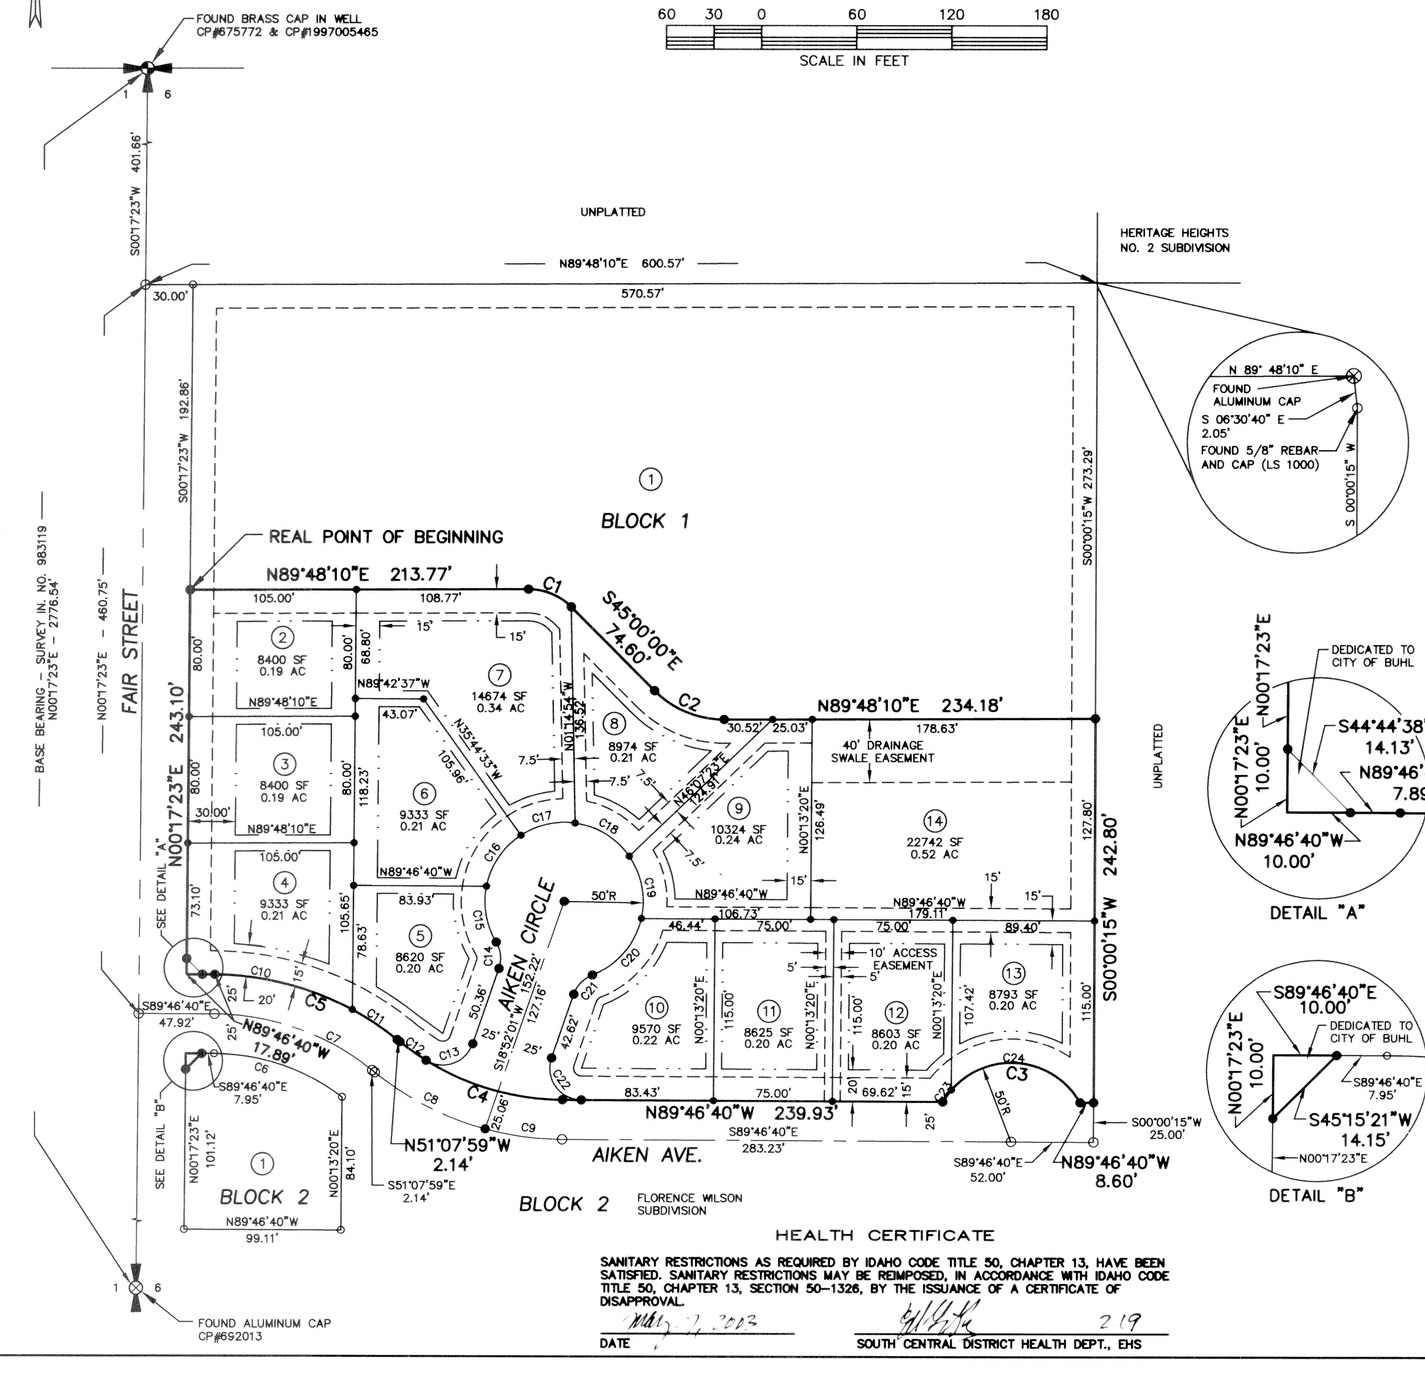

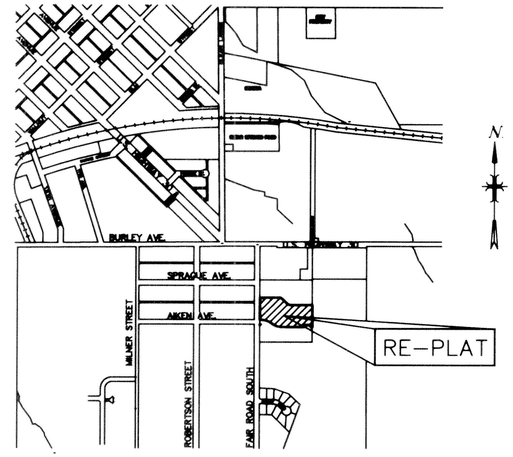

VICINITY MAP – N.T.S.

LEGEND

- BRASS CAP MONUMENT
- SET 5/8" IRON PIN W/ PLASTIC CAP
- SET 1/2" X 24" IRON PIN W/ PLASTIC CAP
- ALUMINUM CAP
- FOUND 5/8" IRON PIN W/ PLASTIC CAP
- FOUND 1/2" IRON PIN W/ PLASTIC CAP
- BUILDING ENVELOPE
- BOUNDARY LINE
- LOT LINE
- UTILITY, DRAINAGE AND IRRIGATION EASEMENT LINE

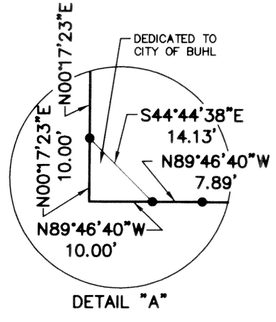

DETAIL "A"

DETAIL "B"

CURVE TABLE						
CURVE	RADIUS	DELTA	L	T	CH L	CH BRG
C1	38.00'	45°11'50"	29.98'	15.82'	29.20'	N67°35'55"W
C2	62.00'	45°11'50"	48.91'	25.81'	47.65'	S67°35'55"E
C3	50.00'	120°00'00"	104.72'	86.60'	86.60'	N89°46'40"W
C4	165.00'	38°38'41"	111.29'	57.85'	109.19'	S70°27'19"E
C5	185.00'	38°38'41"	124.78'	64.87'	122.43'	N70°27'19"W
C6	135.00'	36°53'01"	86.90'	45.02'	85.41'	N71°20'10"W
C7	160.00'	38°38'41"	107.92'	56.10'	105.88'	N70°27'19"W
C8	190.00'	23°48'14"	78.94'	40.05'	78.37'	S63°02'06"E
C9	190.00'	14°50'27"	49.21'	24.75'	49.08'	S82°21'27"E
C10	185.00'	28°04'53"	90.67'	46.27'	89.77'	N75°44'14"W
C11	185.00'	10°33'48"	34.11'	17.10'	34.06'	N56°24'53"W
C12	165.00'	7°05'25"	20.42'	10.22'	20.41'	S54°40'42"E
C13	20.00'	102°54'35"	35.92'	25.10'	31.28'	N70°19'18"E
C14	20.00'	49°59'41"	17.45'	9.33'	16.90'	N06°07'50"W
C15	50.00'	42°00'50"	36.66'	19.20'	35.85'	S10°07'15"E
C16	50.00'	45°47'25"	39.96'	21.12'	38.90'	S33°46'53"W
C17	50.00'	40°58'29"	35.76'	18.68'	35.00'	S77°09'49"W
C18	50.00'	47°23'21"	41.35'	21.94'	40.19'	N58°39'16"W
C19	50.00'	47°23'21"	41.35'	21.94'	40.19'	N11°15'56"W
C20	50.00'	56°25'57"	49.25'	26.83'	47.28'	N40°38'43"E
C21	20.00'	49°59'41"	17.45'	9.33'	16.90'	S43°51'52"W
C22	20.00'	108°38'41"	37.92'	27.86'	32.49'	S35°27'19"E
C23	50.00'	10°40'08"	9.31'	4.67'	9.30'	S35°33'24"W
C24	50.00'	109°19'52"	95.41'	70.53'	81.58'	N84°26'36"W

HEALTH CERTIFICATE

SANITARY RESTRICTIONS AS REQUIRED BY IDAHO CODE TITLE 50, CHAPTER 13, HAVE BEEN SATISFIED. SANITARY RESTRICTIONS MAY BE REIMPOSED, IN ACCORDANCE WITH IDAHO CODE TITLE 50, CHAPTER 13, SECTION 50-1326, BY THE ISSUANCE OF A CERTIFICATE OF DISAPPROVAL.

May 7, 2003
DATE

219
SOUTH CENTRAL DISTRICT HEALTH DEPT., EHS

J–U–B ENGINEERS, INC.
Engineers Surveyors Planners
Twin Falls, Idaho